


SEE WEBSITE FOR CARTRIDGE AND GASKET REMOVAL INSTRUCTIONS
IF YOU DO NOT HAVE 5874 OWNERS MANUAL AVAILABLE.

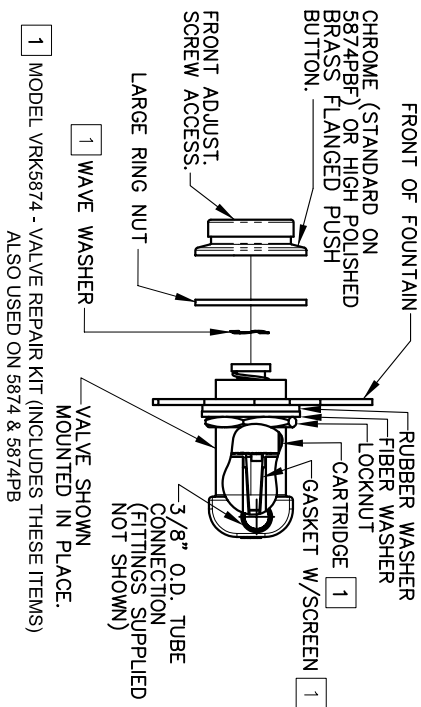

1 MODEL VPK5874 - VALVE REPAIR KIT (INCLUDES THESE ITEMS)
ALSO USED ON 5874 & 5874PB

INSTALLATION INSTRUCTIONS FOR 5874PBF

- 1.) INSERT VALVE INTO FOUNTAIN FROM INSIDE.
- 2.) THREAD LARGE RING NUT ONTO VALVE BODY, APPROX. 1" INTO VALVE.
- 3.) PLACE WAVE WASHER INSIDE OF FLANGED PUSH-BUTTON ASSY.
- 4.) APPLY ONE (1) DOT OF LOCTITE 222MS, ON THE FEMALE THREADS OF BUTTON ASSEMBLY, LEAVING THE FIRST AND LAST THREADS FREE. (FIGURE1). CAUTION: EXCESS LOCTITE CAN CAUSE THREADS TO LOCK VERY TIGHTLY, MAKING REPAIRS DIFFICULT.
- 5.) THREAD FLANGED PUSH-BUTTON ASSY. ON VALVE UNTIL WAVE WASHER MAKES CONTACT WITH STEM OF CARTRIDGE. CAUTION: DO NOT HAND TIGHTEN.
- 6.) UNTHREAD LARGE RING NUT FORWARD, UNTIL IT STOPS FLUSH WITH FLANGED PUSH-BUTTON ASSY.
- 7.) PUSH VALVE BACK TOWARD THE INSIDE OF FOUNTAIN AND TIGHTEN LOCK NUT. (SEE ILLUSTRATION ABOVE.)
- 8.) TIGHTEN FLANGED PUSH-BUTTON ASSY. USING UNIVERSAL SPANNER WRENCH PROVIDED.

*APPLY 1 DOT OF LOCTITE 222MS

*THIS ALSO APPLIES TO PBA6 AND PBA6HPB


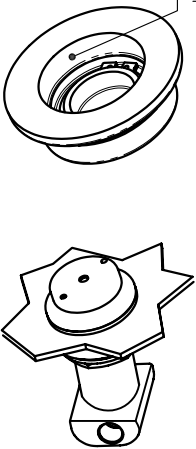


FIGURE 1 ASSEMBLED 5874PBF

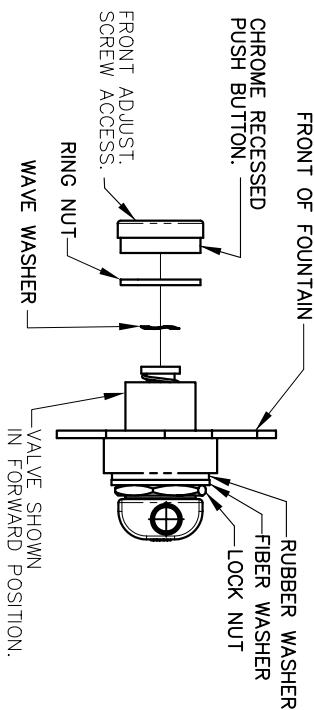

INSTALLATION INSTRUCTIONS FOR 5874PB

- 1.) VERIFY THAT LOCK NUT, FIBER AND RUBBER WASHERS ARE AT BOTTOM OF VALVE.
- 2.) INSERT VALVE INTO FOUNTAIN FROM INSIDE, AND PUSH FORWARD (SEE ILLUSTRATION ABOVE).
- 3.) THREAD RING NUT ONTO VALVE BODY, AS FAR AS POSSIBLE TOWARDS FRONT OF FOUNTAIN.
- 4.) PLACE WAVE WASHER INSIDE OF FLANGED PUSH-BUTTON ASSY.
- 5.) APPLY ONE (1) DOT OF LOCTITE 222MS, ON THE FEMALE THREADS OF BUTTON ASSEMBLY, LEAVING THE FIRST AND LAST THREADS FREE. (FIGURE 2). CAUTION: EXCESS LOCTITE CAN CAUSE THREADS TO LOCK VERY TIGHTLY, MAKING REPAIRS DIFFICULT.
- 6.) THREAD PUSH-BUTTON ASSY. ON VALVE UNTIL WAVE WASHER MAKES CONTACT WITH STEM OF CARTRIDGE. CAUTION: DO NOT HAND TIGHTEN.
- 7.) UNTHREAD RING NUT FORWARD, UNTIL IT STOPS FLUSH WITH PUSH-BUTTON ASSY.
- 8.) PUSH VALVE BACK TOWARD THE INSIDE OF FOUNTAIN AND TIGHTEN LOCK NUT. (SEE ILLUSTRATION ABOVE.)
- 9.) TIGHTEN PUSH-BUTTON ASSY. USING UNIVERSAL SPANNER WRENCH PROVIDED.

*APPLY 1 DOT OF LOCTITE 222MS

*THIS ALSO APPLIES TO PBA7

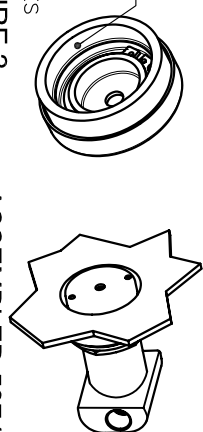


FIGURE 2 ASSEMBLED 5874PB



1455 KLEPPE LANE
SPARKS, NEVADA 89431
(775) 359-4712 FAX (775) 359-7424
E-MAIL: HAWS@HAWS.CO.COM
WEBSITE: WWW.HAWS.CO.COM

EQ. NO.:	718595789	REV.:	MODEL(S):	0002077535 D
DATE:	EON: 4/30/02	DATE:	5874/5874PB/5874PBF/VK5874/PBA6/PBA6HPB/PBA7	0002077535 D 11
APPROVER:	11/04/02	DATE:	INFO FAX DOC #:	25874/258742
		DATE:	ISSUE:	A
		DATE:	REVISION:	1 OF 1