

FEATURES & BENEFITS

DESIGN

With its patented push-button design which allows for front access stream adjustment as well as cartridge and strainer access, this valve offers the ultimate in ease of maintenance.

VALVE

The push-button activated valve offers the only all stainless steel valve body that is machined out of solid bar stock, is fully serviceable through the front of the push button assembly offering access to the water control cartridge and integral water supply strainer, and with front access to the water stream height adjustment for easy maintenance without having to remove the valve. Operating pressure range of 30 to 90 psi (2.1 to 6.2 bar).

PUSH BUTTON

All chrome plated brass push button resists vandalism by allowing it to spin without unscrewing.



OPTIONS

- Valve Repair Kit: Model VRK5874, valve repair kit for Model 5874.

For more information, visit www.hawscow.com or call (888) 640-4297.


SPECIFICATIONS

Model 5874PB push-button activated fountain valve is the only all stainless steel valve body that is machined out of solid bar stock, is fully serviceable through the front of the push button assembly offering access to the water control cartridge and integral water supply strainer, and with front access to the water stream height adjustment for easy maintenance without having to remove the valve. Operating pressure range of 30 to 90 psi (2.1 to 6.2 bar).

APPLICATIONS

Specifically, this type of valve/button assembly is used as a replacement valve for many Haws fountains, whether it is to replace an existing 5874 valve or to change out the older style 5872 valve assembly. Haws manufactures drinking fountains, faucets and electric water coolers to be lead-free by all known definitions including NSF/ANSI/CAN 61- Section 9, NSF/ANSI/CAN 372, California Proposition 65, and the Federal Safe Drinking Water Act. Product is compliant to California Health and Safety Code 116875 (AB 1953-2006), and NSF/ANSI/CAN 61: Q ≤ 0.5.



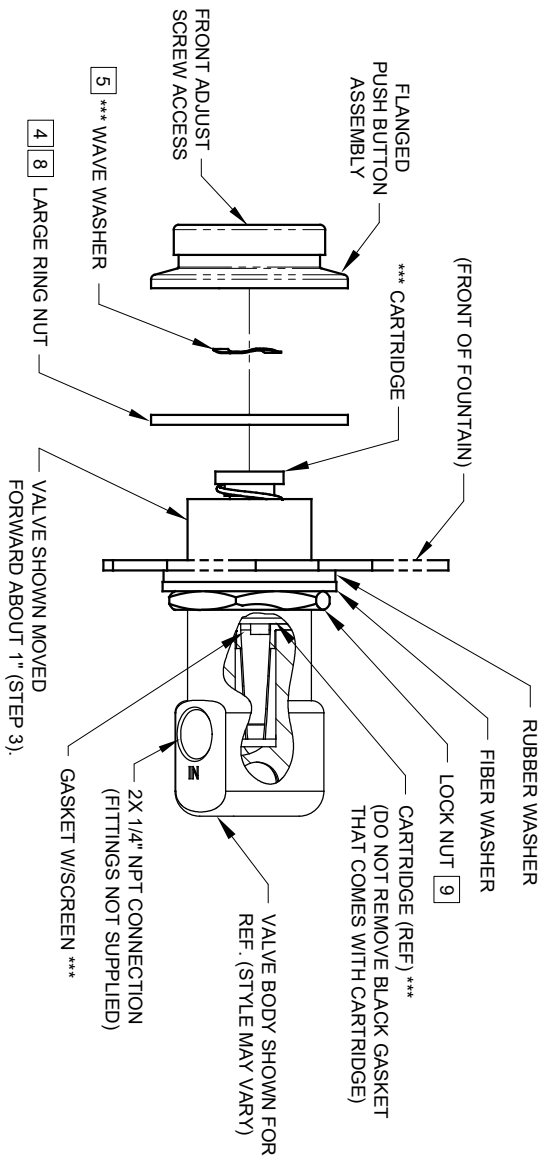

*** MODEL VRK5874 & VRK5874HF- VALVE REPAIR KITS INCLUDE THESE ITEMS
(SEE SHEET 3 OF 3 FOR REPLACEMENT INSTRUCTIONS)

INSTALLATION/REPLACEMENT INSTRUCTIONS FOR 5874PBF

1) FOLLOW INSTRUCTIONS CAREFULLY ON O&M MANUAL (PAGE 2 OF 7) WHEN REMOVING OLD VALVE. **NOTE: SEE PARTS BREAKDOWN (PAGE 4 OF 7) FOR ADDITIONAL NOTES.**

2) VERIFY THAT LOCK NUT, FIBER, AND RUBBER WASHERS ARE POSITIONED SLIGHTLY PAST MIDWAY OF THREADS ON NEW VALVE BODY.

3) INSERT VALVE INTO BRACKET FROM INSIDE AND PUSH FORWARD ABOUT 1".

4) THREAD LARGE RING NUT ONTO VALVE BODY, APPROXIMATELY 1" INTO VALVE.

5) PLACE WAVE WASHER INSIDE OF FLANGED PUSH BUTTON ASSEMBLY (**MUST ALWAYS BE IN PLACE**).

6) APPLY ONE (1) DOT OF LOCTITE 222MS, ON THE FEMALE THREADS OF BUTTON ASSEMBLY LEAVING THE FIRST AND LAST THREADS FREE. (FIGURE 1). **CAUTION: EXCESS LOCTITE CAN CAUSE THREADS TO LOCK VERY TIGHTLY, MAKING REPAIRS DIFFICULT.**


7) THREAD FLANGED PUSH BUTTON ASSEMBLY ON VALVE UNTIL WAVE WASHER MAKES SLIGHT CONTACT WITH STEM OF CARTRIDGE. **CAUTION: DO NOT HAND-TIGHTEN.

8) UNTHREAD RING NUT FORWARD UNTIL IT STOPS FLUSH WITH PUSH BUTTON ASSEMBLY.

9) PUSH VALVE BACK TOWARD THE INSIDE OF BRACKET AND TIGHTEN LOCKNUT (SEE ILLUSTRATION ABOVE).

10) TIGHTEN PUSH BUTTON ASSEMBLY USING UNIVERSAL SPANNER WRENCH PROVIDED WITH MODEL 5874PBF.

** OVERTIGHTENING WILL PRE-ACTUATE VALVE AND CAUSE WEEPAGE, WHILE NOT ENOUGH CONTACT BETWEEN WAVE WASHER AND STEM CAN CAUSE A LOW FLOW CONDITION.

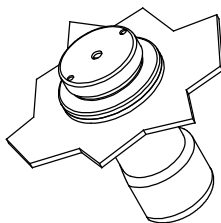

ASSEMBLED 5874PBF
(FLUSH MOUNT APPLICATION ONLY)

SEE SHEET 2 OF 3 FOR 5874PBF RECESSED MOUNT INSTRUCTIONS.


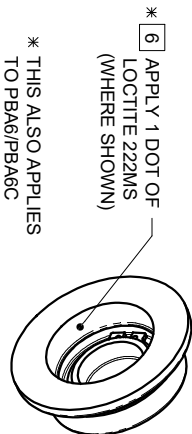


FIGURE 1

NOTE!
THIS VALVE IS PRESSURE COMPENSATING.
BE SURE TO REMOVE ANY EXISTING FLOW
CONTROL DEVICES. (MAY BE PRESENT IN
FITTING OR SPUD).

		Haws®		1455 KLEPPE LANE SPARKS, NEVADA 89431 (775) 359-4712 FAX (775) 359-7424 E-MAIL: HAWS@HAWS.CO.COM WEBSITE: WWW.HAWS.CO.COM	
ECN NO. REVISED PER BY: 4250 ECN 5945 FV		MODEL(S) 5874PBF/5874PBF/VRK5874V/VRK5874HF/ PBA6/PBA6C/PBA7/PBA7C		PART NUMBER 0002077650.D	
DRAWN: DATE: 06/09/16 CHKD: J.C.				REVISION 11	
APPROVED: FV 06/27/23		SCALE: NA DRAWING TYPE: INSTALLATION		SIZE: A SHEET 1 OF 3	

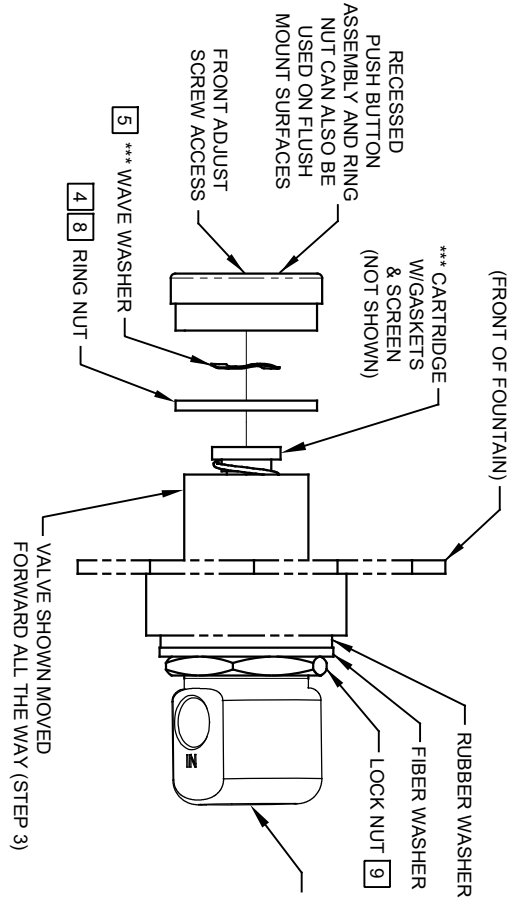

*** MODEL VRK5874 & VRK5874HF - VALVE REPAIR KITS INCLUDE THESE ITEMS
(SEE SHEET 3 OF 3 FOR REPLACEMENT INSTRUCTIONS)

INSTALLATION/REPLACEMENT INSTRUCTIONS FOR 5874PB

- 1) FOLLOW INSTRUCTIONS CAREFULLY ON O&M MANUAL (PAGE 2 OF 7) WHEN REMOVING OLD VALVE. **NOTE: SEE PARTS BREAKDOWN (PAGE 4 OF 7) FOR ADDITIONAL NOTES.**
- 2) VERIFY THAT LOCK NUT, FIBER WASHER, AND RUBBER WASHERS ARE POSITIONED TOWARD BOTTOM END OF THREADS ON NEW VALVE BODY.
- 3) INSERT VALVE INTO BRACKET FROM INSIDE, AND PUSH ALL THE WAY FORWARD (SEE ILLUSTRATION ABOVE).

- 4) THREAD RING NUT ONTO VALVE BODY, AS FAR IN AS POSSIBLE, TOWARD FRONT OF FOUNTAIN. **NOTE: IF REPLACING A 5871 OR 5872 SERIES VALVE, YOU MAY HAVE TO CONTACT HAWS TECHNICAL SUPPORT.**
- 5) PLACE WAVE WASHER INSIDE OF PUSH BUTTON ASSEMBLY (MUST ALWAYS BE IN PLACE).

- 6) APPLY ONE (1) DOT OF LOCTITE 222MS, ON THE FEMALE THREADS OF BUTTON ASSEMBLY LEAVING THE FIRST AND LAST THREADS FREE. (FIGURE 1). **CAUTION: EXCESS LOCTITE CAN CAUSE THREADS TO LOCK VERY TIGHTLY, MAKING REPAIRS DIFFICULT.**

- **7) THREAD PUSH BUTTON ASSEMBLY ON VALVE UNTIL WAVE WASHER MAKES SLIGHT CONTACT WITH STEM OF CARTRIDGE. **CAUTION: DO NOT HAND-TIGHTEN.**


- 8) UNTHREAD RING NUT FORWARD UNTIL IT STOPS FLUSH WITH PUSH BUTTON ASSEMBLY.

- 9) PUSH VALVE BACK TOWARD THE INSIDE OF BRACKET AND TIGHTEN LOCKNUT (SEE ILLUSTRATION ABOVE).

- 10) TIGHTEN PUSH BUTTON ASSEMBLY USING UNIVERSAL SPANNER WRENCH PROVIDED WITH MODEL 5874PB.

** OVERTIGHTENING WILL PRE-ACTUATE VALVE AND CAUSE WEEPAGE. WHILE NOT ENOUGH CONTACT BETWEEN WAVE WASHER AND STEM CAN CAUSE A LOW FLOW CONDITION.

ASSEMBLED 5874PB
(RECESSED MOUNT APPLICATION SHOWN)
SEE SHEET 1 OF 3 FOR FLUSH MOUNT INSTRUCTIONS.

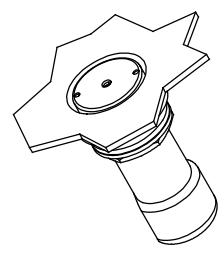

* [6] APPLY 1 DOT OF
LOCTITE 222MS
(WHERE SHOWN)

* THIS ALSO APPLIES
TO PBA7/PBA7C



FIGURE 1

NOTE!
THIS VALVE IS PRESSURE COMPENSATING.
BE SURE TO REMOVE ANY EXISTING FLOW
CONTROL DEVICES. (MAY BE PRESENT IN
FITTING OR SPUD).

**Haws®**

1456 KLEPPE LANE
SPARKS, NEVADA, 89431
(775) 359-4712 FAX (775) 359-7424
E-MAIL: HAWS@HAWS.CO.COM
WEBSITE: WWW.HAWS.CO.COM

ECN NO. REVISED PER BY:		MODEL(S)	
4250	ECN 5945 FV	5874PB/5874PBF/VRK5874/VRK5874HF/ PBA6/PBA6C/PBA7/PBA7C	
DRAWN: LM	DATE: 06/09/16	CHKD: JC	
APPROVED: FV	DATE: 09/27/23	SCALE: NA	DRAWING TYPE: INSTALLATION
PART NUMBER		SIZE: A	SHEET 2 OF 3
0002077650.D			
REVISION			
11			


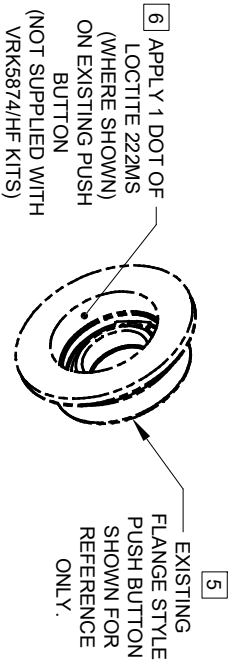


FIGURE 1

REPLACEMENT INSTRUCTIONS FOR VRK5874/VRK5874HF

- 1) FOLLOW INSTRUCTIONS CAREFULLY ON O&M MANUAL (PAGE 2 OF 7) WHEN REMOVING VALVE. **NOTE: SEE PARTS BREAKDOWN (PAGE 4 OF 7) FOR ADDITIONAL NOTES.**
- 2) REMOVE FRONT PUSH BUTTON (WITH WAVE WASHER INSIDE) AND RETAINING NUT WITH THE UNIVERSAL SPANNER WRENCH (PN 0006983506 - NOT SUPPLIED WITH VRK5874 AND VRK5874HF KITS).
- 3) PULL EXISTING CARTRIDGE ASSEMBLY WITH GASKET SCREEN OUT.
- 4) WHEN INSERTING NEW CARTRIDGE ASSEMBLY WITH GASKET SCREEN, FOLLOW THESE IMPORTANT STEPS:
 - MAKE SURE THERE IS NO DEBRIS IN THE VALVE BODY BEFORE INSERTING THE CARTRIDGE ASSEMBLY INTO THE VALVE BODY.
 - ALIGN STRAINER WITH LARGE HOLE IN THE VALVE BODY AND ENSURE THE OUTLET PORT ON CARTRIDGE IS ALSO PROPERLY ALIGNED WITH SMALLER OPENING IN VALVE BODY BY TURNING SLIGHTLY INTO PLACE.
 - CONFIRM CARTRIDGE HAS BOTTOMED OUT PROPERLY BEFORE INSTALLING RETAINING NUT.
 - THREAD RETAINING NUT UNTIL IT CONTACTS THE CARTRIDGE, THEN TIGHTEN 1-1/4 TURN FARTHER, CHECK FOR LEAKS.
 - (CAUTION: WHEN REPLACING CARTRIDGE W/GASKET ASSEMBLY, DAMAGE CAN OCCUR IF NOT PROPERLY RE-INSTALLED).
- 5) PLACE WAVE WASHER (EXISTING OR NEW) INSIDE OF PUSH BUTTON ASSEMBLY (MUST ALWAYS BE IN PLACE).
- 6) APPLY ONE (1) DOT OF LOCOTITE 222MS. ON THE FEMALE THREADS OF EXISTING BUTTON ASSEMBLY LEAVING THE FIRST AND LAST THREADS FREE. (SEE FIGURE 1). **CAUTION: EXCESS LOCOTITE CAN CAUSE THREADS TO LOCK VERY TIGHTLY, MAKING REPAIRS DIFFICULT.**
- ** 7) THREAD EXISTING PUSH BUTTON ASSEMBLY ON VALVE UNTIL WAVE WASHER MAKES SLIGHT SLIGHT CONTACT WITH STEM OF CARTRIDGE. **CAUTION: DO NOT HAND-TIGHTEN.**
- 8) TIGHTEN EXISTING PUSH BUTTON ASSEMBLY USING UNIVERSAL SPANNER WRENCH (PN 0006983506 NOT SUPPLIED WITH VRK5874 AND VRK5874HF KITS).

** OVERTIGHTENING WILL PRE-ACTUATE VALVE AND CAUSE WEEPAGE, WHILE NOT ENOUGH CONTACT BETWEEN WAVE WASHER AND STEM CAN CAUSE A LOW FLOW CONDITION.

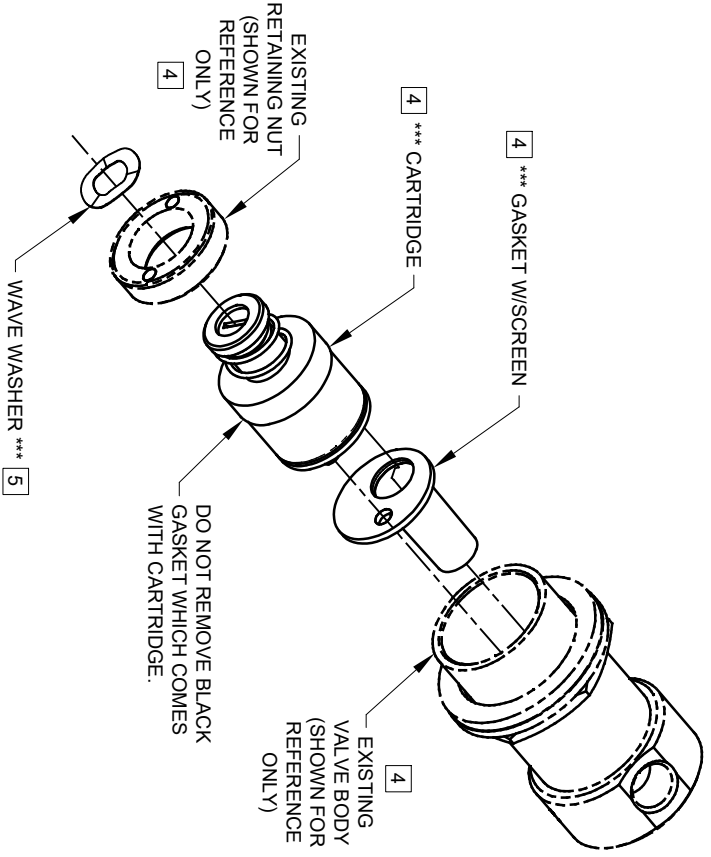

NOTE!
THIS VALVE IS PRESSURE COMPENSATING.
BE SURE TO REMOVE ANY EXISTING FLOW
CONTROL DEVICES. (MAY BE PRESENT IN
FITTING OR SPUD).

		1456 KLEPPE LANE SPARKS, NEVADA 89431 (775) 359-4712 FAX (775) 359-7424 E-MAIL: HAWS@HAWS.CO.COM WEBSITE: WWW.HAWS.CO.COM	
ECN NO. REVISED PER BY:	MODEL(S)	PART NUMBER	
5945 1 ECN 5945 FV	5874PB/5874PBF/VRK5874/VRK5874HF/	0002077650.D	
DRAWN: DATE: CHK'D:	DATE: DATE: DATE:	REVISION	
FV 09/01/23 JC	FV 09/01/23 JC	11	
APPROVED: DATE:	SCALE: NA	DRAWING TYPE:	
FV 09/27/23	SCALE: NA	INSTALLATION	
SIZE: A		SHEET 3 OF 3	