

# INSTALLATION, OPERATION & MAINTENANCE INSTRUCTIONS

1455 Kleppe Lane ◆Sparks, NV 89431-6467 ◆(775) 359-4712 ◆Fax (775) 359-7424 E-mail: haws@hawsco.com ◆ website: www.hawsco.com

No. 2076415 (14)

## Model 1025/1025G Drinking Fountain

NOTE TO INSTALLER: Please leave this information with the Maintenance Department.

### LIMITED WARRANTY

HAWS warrants that all of its products are guaranteed against defective material or poor workmanship for a period of one year from date of shipment. HAWS liability under this warranty shall be discharged by furnishing without charge F.O.B. HAWS Factory any goods, or part thereof, which shall appear to the Company upon inspection to be of defective material or not of first class workmanship, provided that claim is made in writing to company within a reasonable period after receipt of the product. Where claims for defects are made, the defective part or parts shall be delivered to the Company, prepaid, for inspection. HAWS will not be liable for the cost of repairs, alterations or replacements, or for any expense connected therewith made by the owner or his agents, except upon written authority from HAWS, Sparks. Nevada. HAWS will not be liable for any damages caused by defective materials or poor workmanship, except for replacements, as provided above. Buyer agrees that Haws has made no other warranties either expressed or implied in addition to those above stated, except that of title with respect to any of the products or equipment sold hereunder and that HAWS shall not be liable for general, special, or consequential damages claimed to arise under the contract of sale. The drinking fountain manufactured by HAWS is warranted to function if installation and maintenance instructions provided are adhered to. The units also must be used for the purpose for which they were intended.

NO OTHER WARRANTIES EXPRESSED OR IMPLIED ARE AUTHORIZED, PROVIDED OR GIVEN BY HAWS.

SHOULD YOU EXPERIENCE DIFFICULTY WITH THE INSTALLATION OF THIS MODEL PLEASE CALL:

TECHNICAL SUPPORT: 1-800-766-5612

FOR CUSTOMER SERVICE: 1-888-640-4297

03/17 Model 1025/1025G Page 1 of 4

**RECOMMENDED TOOLS:** Hack saw, pipe joint sealant, screwdriver, level, 12" adjustable wrench, 10" pipe wrench, 5/64" hex key wrench, 9/16", 1/2", 7/16" socket wrench or open end wrench.

**LOCATION OF UNIT:** The Model 1025/1025G Drinking Fountain is a wheelchair accessible drinking water facility. The height dimensions shown meet current ADA requirements. When installing this unit, local, state or federal codes should be adhered to. If height other than shown is required, then dimensions must be adjusted accordingly.

**SUPPLY LINE:** The minimum recommended line size is 1/2"IPS with 30-90 psi (2-6 ATM) pressure. Where sediment or mineral content is a problem, an inlet filter is recommended.

**PLUMBING CONNECTIONS:** Inlet is 3/8"O.D. compression fitting. Waste outlet is female 1-1/2"IPS.

**MAINTENANCE:** Periodically clean the strainer. Refer to 5874 Series Valve Operation and Maintenance sheet for more information.

	TROUBLESHOOTING					
	PROBLEM		REPAIR CHECKLIST			
1.	Insufficient bubbler flow.	1a.	Check that inlet screwdriver stop valve (not supplied) is wide open.			
		1b.	Verify minimum 30 psi supply pressure.			
		1c.	Clean strainer. See 5874 Series Valve Manual.			
		1d.	Adjust valve to increase flow. Use front adjust screw or see 5874 Series Valve Manual.			

#### **General Notes:**

Before tightening nut and ferrule assembly, push tubing into fitting until it bottoms out to ensure correct engagement with O-Ring.

For more information about Haws products, see our website: <a href="www.hawsco.com">www.hawsco.com</a>

© 2017 Haws<sup>®</sup> Corporation – All Rights Reserved HAWS<sup>®</sup> and other trademarks used in these materials are the exclusive property of Haws Corporation


THIS DOCUMENT IS TRUE AND CORRECT AT TIME OF PUBLICATION. CONTINUED PRODUCT IMPROVEMENTS MAKE SPECIFICATIONS AND MEASUREMENTS SUBJECT TO CHANGE WITHOUT NOTICE.


#### NOTES:

1 5874PB (ITEM 2) INCLUDES VRK5874 CARTRIDGE ASSEMBLY (ITEM 3) AND PBA7 RECESSED PUSH BUTTON (ITEM 4).

2 ENSURE TUBE IS DISCONNECTED FROM PUSH BUTTON VALVE BODY PRIOR TO REMOVAL. APPLY ONE DROP OF LOCTITE 222MS TO NOZZLE THREADS PRIOR TO FASTENING BACK ONTO BUBBLER HEAD. RE-ATTACH TUBE TO VALVE.

ITEM	DESCRIPTION	1025/1025
1	STRAINER, WASTE ASSEMBLY	6466
2	BUTTON, PUSH, RECESSED, PCP W/ VALVE	5874PB
3	VALVE REPAIR KIT	VRK5874
4	BUTTON ASSEMBLY, PUSH, 5874	PBA7
5	BUBBLER HEAD ASSEMBLY, PCP	5703M
6	PLATE, BOTTOM	PBM1025
7	TRAP	0005987000

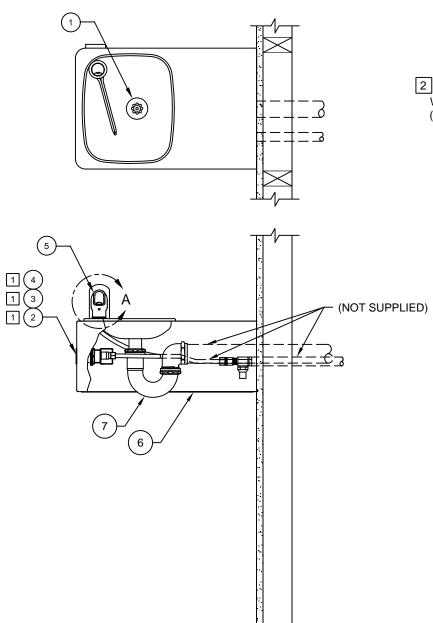

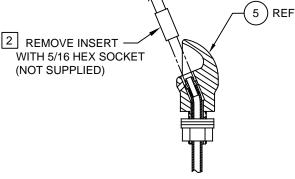

**DETAIL A ROTATED 90° INTO VIEW** 

## **PARTS BREAKDOWN**



1455 KLEPPE LANE SPARKS, NEVADA 89431 (775) 359-4712 FAX (775) 359-7424 E-MAIL: HAWS@HAWSCO.COM

MODEL(S) 1025/1025G **DRINKING FOUNTAIN** 

0002076415